### **HCAT PROJECT**

# FUNCTIONAL ROD/SEAL TESTING AND QUALIFICATION OF HVOF COATINGS ON NAVY ACTUATORS



Jeff Gribble

NAS Patuxent River, MD

March 16, 2005 HCAT

Public reporting burden for the collection of information is estimated to average 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection of information. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden, to Washington Headquarters Services, Directorate for Information Operations and Reports, 1215 Jefferson Davis Highway, Suite 1204, Arlington VA 22202-4302. Respondents should be aware that notwithstanding any other provision of law, no person shall be subject to a penalty for failing to comply with a collection of information if it does not display a currently valid OMB control number.						
1. REPORT DATE 16 MAR 2005		2. REPORT TYPE		3. DATES COVE <b>00-00-2005</b>	red to 00-00-2005	
4. TITLE AND SUBTITLE				5a. CONTRACT	NUMBER	
Functional Rod/Seal Testing and Qualification of HVOF Coatings on			oatings on	5b. GRANT NUMBER		
Navy Actuators				5c. PROGRAM ELEMENT NUMBER		
6. AUTHOR(S)				5d. PROJECT NUMBER		
				5e. TASK NUMBER		
				5f. WORK UNIT NUMBER		
7. PERFORMING ORGANIZATION NAME(S) AND ADDRESS(ES)  Naval Air Warfare Center,22347 Cedar Point Road,Patuxent  River,MD,20670  8. PERFORMING ORGANIZATION REPORT NUMBER						
9. SPONSORING/MONITORING AGENCY NAME(S) AND ADDRESS(ES)			10. SPONSOR/MONITOR'S ACRONYM(S)			
			11. SPONSOR/MONITOR'S REPORT NUMBER(S)			
12. DISTRIBUTION/AVAIL Approved for publ	LABILITY STATEMENT ic release; distributi	on unlimited				
		d Cadmium Plating P/ESTCP.	Program Review	Meeting, M	arch 15-17, 2005,	
14. ABSTRACT						
15. SUBJECT TERMS						
16. SECURITY CLASSIFICATION OF: 17.			17. LIMITATION OF	18. NUMBER	19a. NAME OF	
a. REPORT unclassified	b. ABSTRACT unclassified	c. THIS PAGE unclassified	ABSTRACT Same as Report (SAR)	OF PAGES 28	RESPONSIBLE PERSON	

**Report Documentation Page** 

Form Approved OMB No. 0704-0188



## **Phase I Rod/Seal Test Status**

- Functional Rod/Seal Testing at PAX Hydraulic Lab is Complete.
  - Pre-test and post-test rod traces were provided by Supfina.
  - Rod and seal pictures provided by NAVAIR Materials.
- HCAT JTP will validate HVOF thermal spray coatings as acceptable replacements for hard chrome plating on hydraulic/pneumatic actuators.
- Phase I test based on HCAT JTP dated 30 Sept 2003 has been modified to include:
  - High Temp at 275°F (not 300°F)
  - MIL-PRF-83282 Fluid Used (not MIL-PRF-87257)





## **Test Apparatus**

- Located at NAVAIR Patuxent River Hydraulic Lab.
- Master hydraulic piston drives four test rods. Each rod passes through two blocks ("Back End Block" and "Far End Block").
- Apparatus is mounted inside an environmental chamber capable of maintaining a temperature between -65° and +300°F.
- The master piston passes through a sealed port on the environmental chamber.
- The hydraulic power supply is located outside the chamber for increased reliability of test hardware. Constant hydraulic pressure is applied on seals.
- Hydraulic lines to the fixture are single-ended and thus should not heat or cool the test hardware.

HCAT March 2005 Greensboro, NC





## **Test Plan**

- 1. Evaluate four different seal configurations with four different rods. Seals tested are those in primary gland position (secondary seals simply act as scraper seals in preventing leakage). Leakage is measured between the primary and secondary gland position.
  - Each rod will be inspected and characterized before and after testing (optical microscopy and surface profilometry).
  - Hydraulic fluid leakage from each block will be measured and recorded.
- 2. Test originally specified 13 day test to total over 1 million cycles of full, super-imposed dither, and dither stroke cycles. Full stroke test time was extended a few days to meet the necessary cycles in JTP due to control valve replacement not operating at proper frequency response.


HCAT March 2005 Greensboro, NC




## NAVWAIR

#### **Stroke Profile**

- Full Stroke (3.5" Stroke, 1.5 second Period, 20 Minute Duration per Hour)
- Superimposed Dither (2" Main Stroke, 0.25" Dither stroke, 4 second Period, 4 Hz Frequency, 20 Minute Duration per Hour)
- Dither (0.25" Dither stroke, 4 Hz Frequency, 20 Minute Duration per Hour)

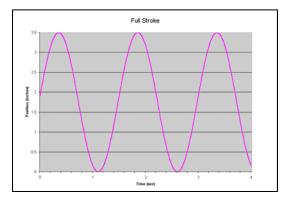



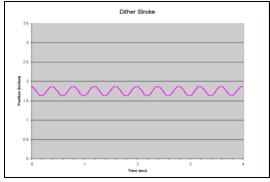

HCAT March 2005 Greensboro, NC



#### **Temperature Profile**

Hours	Temp (°F)
59	160
10	200
10	225
20	250
20	275
5	- 40

Note: Prior to each test day temperature shall begin at 0°F to evaluate static leakage at startup.




## **Test Rod and Seal Layout**

• There are two seal configurations per block and two blocks per rod so that 16 rod/seal configurations are being evaluated per test.

• Primary (test seals) indicated in blue and the secondary (scraper seals) in

magenta. Primary and secondary seals are similar.

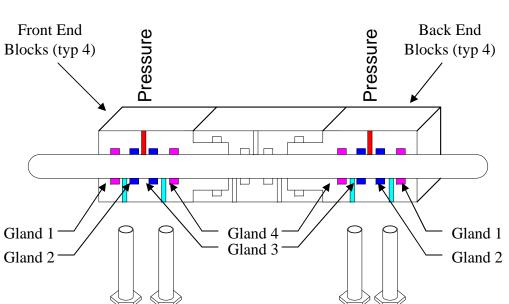



HCAT March 2005 Greensboro, NC



## NAVWAIR

SEAL CONFIGURATIONS	SUPPLIER
No. 1	A
MIL-P-83461 O-ring w/ PTFE Capstrip	
No. 2	B – 1 <sup>st</sup> 27 hrs
MIL-P-83461 O-ring w/ 2 backup rings	A – remainder of test
No. 3	С
Fluorosilicon O-ring w/ PTFE Capstrip	
No. 4	С
Spring energized PTFE seal	





#### Rod 1: "HVOF As-Ground"

Test Article	Supfina, Inc. Taylor-Hobson Cut Off – 0.030 In. WC/Co/Cr 86/10/4 Ground to 4 – 6 Ra 320 grit diamond As Ground		
Pre-Test	Ra = 6.46 microinch		
Post-Test	Location 1: Ra = 4.32 microinch Location 2: Ra = 2.95 microinch		

## Rod 3: "HVOF 8-10 Ground w/ SF"

	Supfina, Inc.	
	Taylor-Hobson	
	Cut Off – 0.030 In.	
Test Article	WC/Co/Cr 86/10/4	
	Ground to 8 – 10 Ra	
	220 grit diamond	
	Superfinished at NADEP JAX to 2 Ra	
Pre-Test	Ra = 1.49 microinch	
Post-Test	Location 1: Ra = 1.28 microinch Location 2: Ra = 1.68 microinch	

## Rod 2: "HVOF 20-22 Ground w/ SF"

	Supfina, Inc.
	Taylor-Hobson
	Cut Off – 0.030 In.
<b>Test Article</b>	WC/Co/Cr 86/10/4
	Ground to 20 – 22 Ra
	120 grit diamond
	Superfinished at NADEP JAX to 2 Ra
Pre-Test	Ra = 2.31 microinch
Post-Test	Location 1: Ra = 2.21 microinch Location 2: Ra = 2.21 microinch

#### Rod 4: "Chrome"


Test Article	Supfina, Inc. Taylor-Hobson Cut Off – 0.030 In. Chrome plated at NADEP JAX Ground to 12 – 15 Ra 60 grit Al2O3 As Ground	
Pre-Test	Ra = 12.27 microinch	
Post-Test	Location 1: Ra = 2.80 microinch Location 2: Ra = 4.82 microinch	

HCAT March 2005 Greensboro, NC







## Rod #1 HVOF 4-6 Ra As-Ground

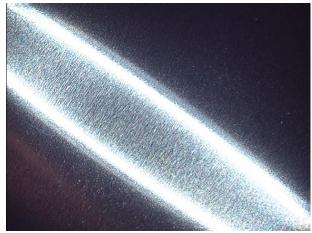

Pre-Test (20x)

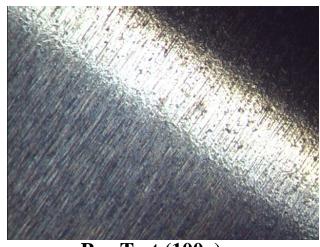

Pre-Test (100x)

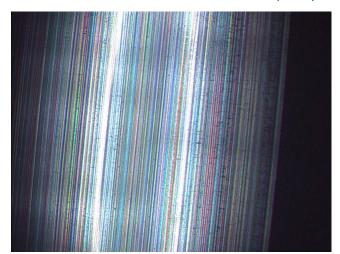

Post-Test (20x)

Post-test linear scratches observed.




Post-Test (100x)

HCAT March 2005 Greensboro, NC







## Rod #2 HVOF 20-22 Ra Ground w/ SF 2 Ra

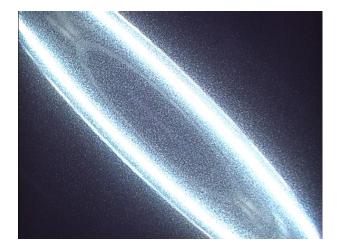

Pre-Test (20x)

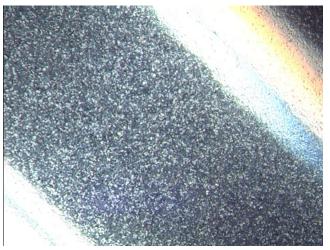

Pre-Test (100x)

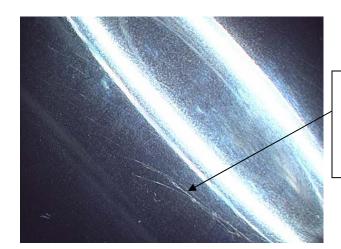

Post-test very fine scratches observed.



Post-Test (100x)

Jeff Gribble
NAVAIR-PAX Hydraulic Systems

Post-Test (20x)

HCAT March 2005 Greensboro, NC





## Rod #3 HVOF 8-10 Ra Ground w/ SF 2 Ra




Pre-Test (20x)



Pre-Test (100x)



Post-test very fine scratches observed.

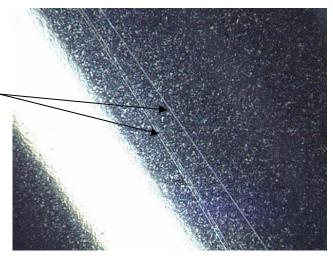

Post-Test (20x)


HCAT March 2005 Greensboro, NC




Post-Test (100x) Jeff Gribble NAVAIR-PAX Hydraulic Systems

## NAVWAIR


## Rod #4 Chrome 12-15 Ra As-Ground

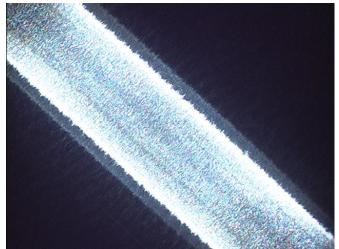

Pre-Test (20x)

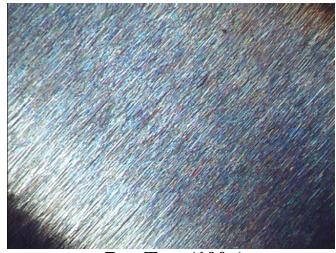


Pre-Test (100x)

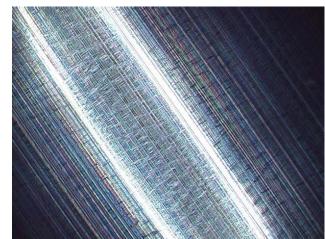

Post-Test (20x)


Post-test linear scratches observed.

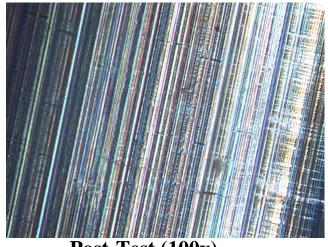


**Post-Test** (100x)


HCAT March 2005 Greensboro, NC




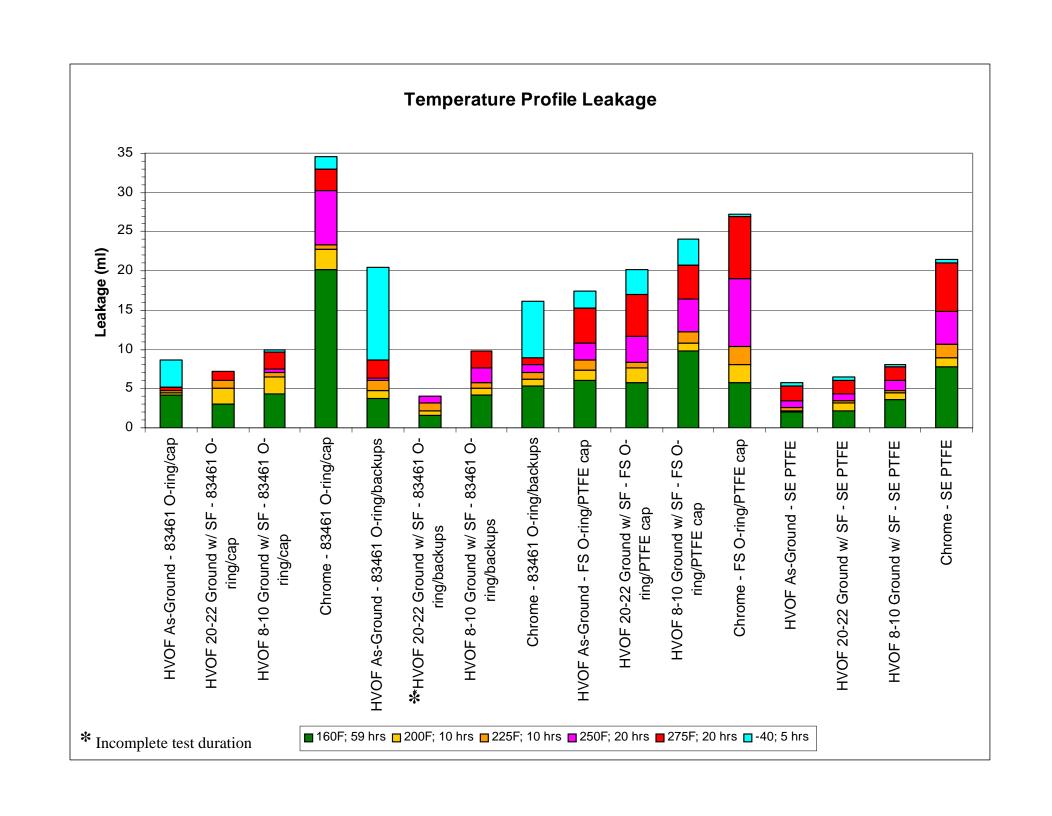

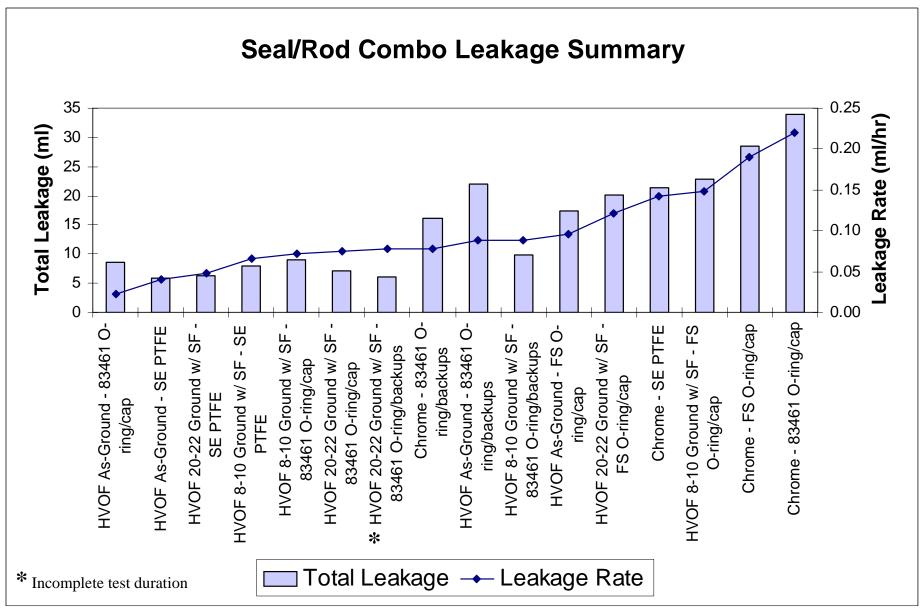




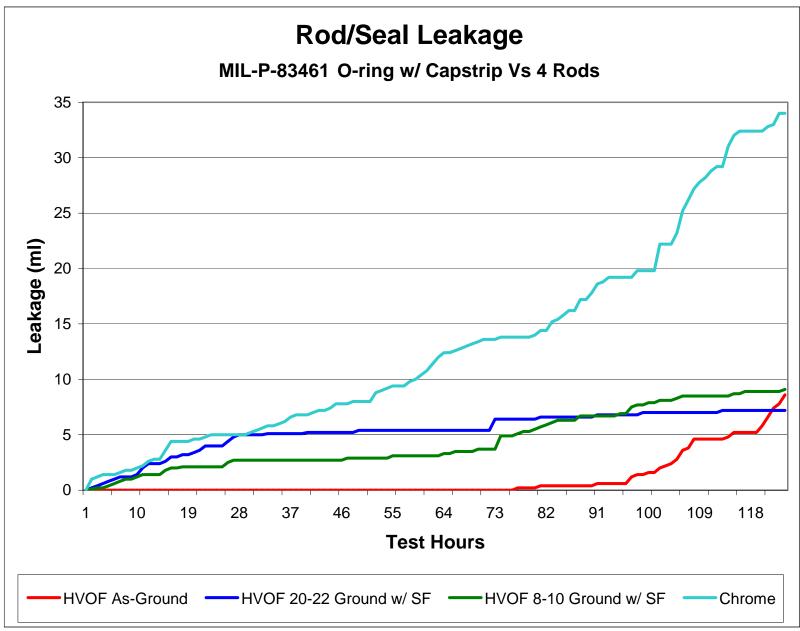


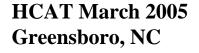




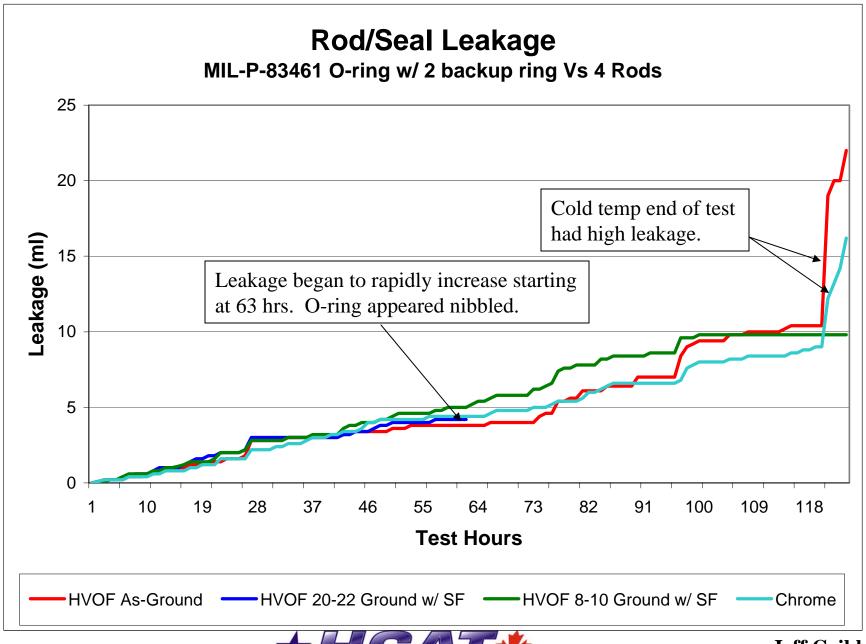



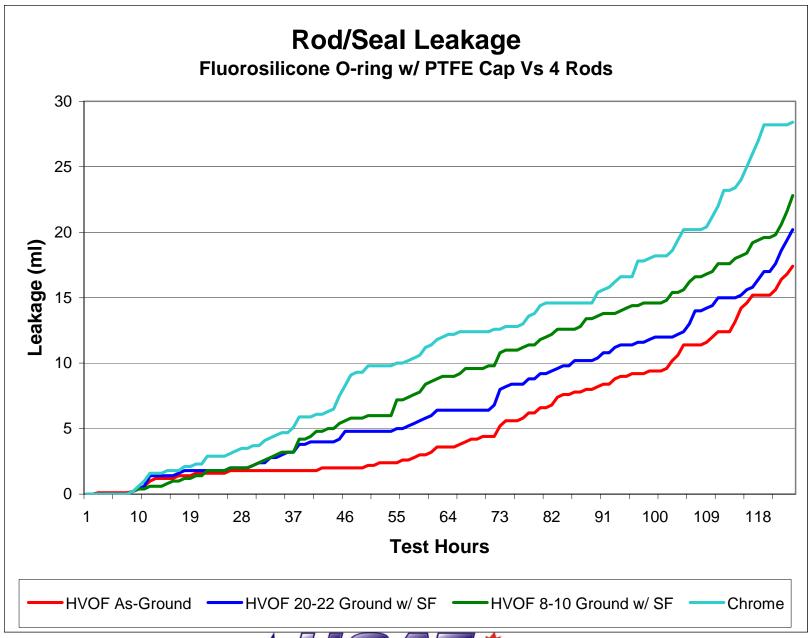




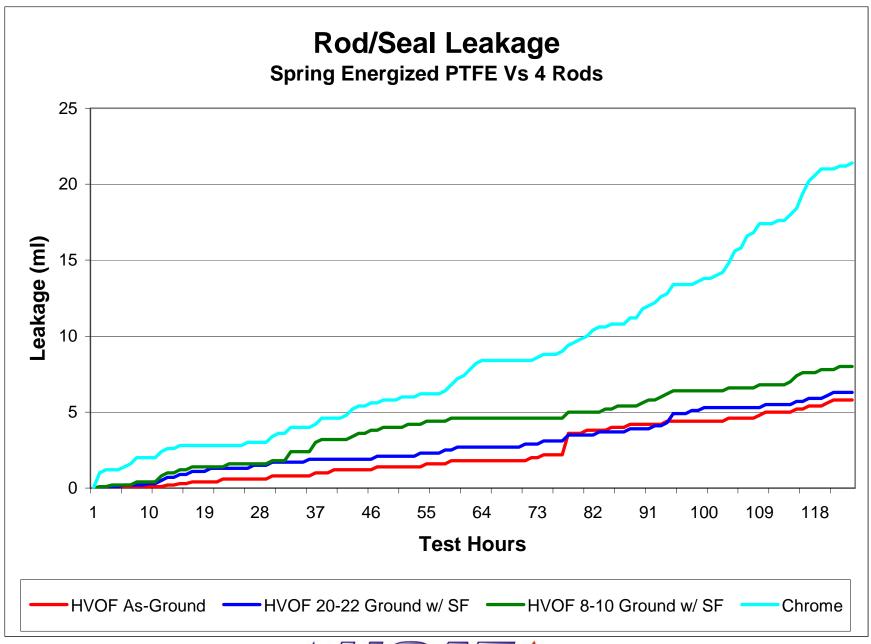





PTFE Cap Seal Wear

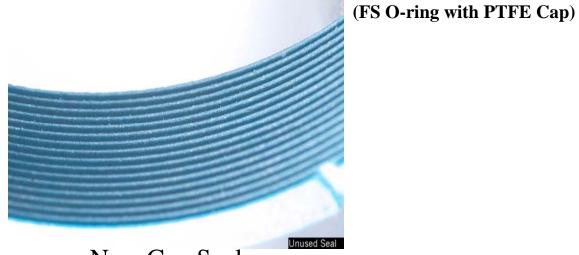


New Cap Seal

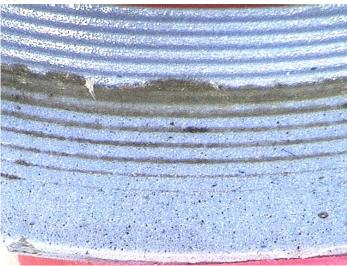

Cap with HVOF 8-10 Ground w/ SF Rod

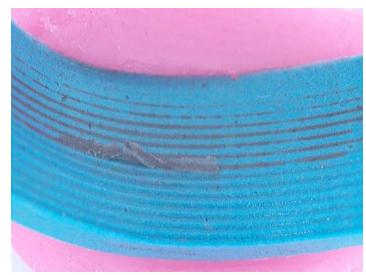

Cap with HVOF 20-22 Ground w/ SF Rod

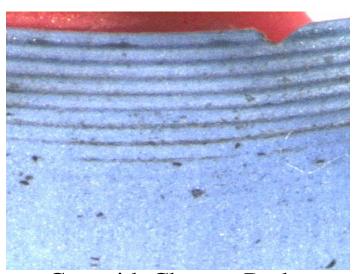


Cap with Chrome Rod

**HCAT March 2005** Greensboro, NC




**Jeff Gribble NAVAIR-PAX Hydraulic Systems** 

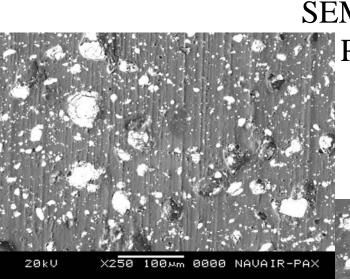

SEM Axial Scratches

PTFE Cap Seal

(FS O-ring/PTFE Cap)

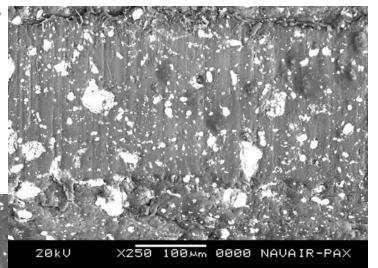


Cap with HVOF 20-22
Ground w/ SF Rod

Cap with HVOF 8-10 Ground w/ SF Rod

X2<del>50 100 мм</del> 2000 NAVAIR-PA

New Cap Seal

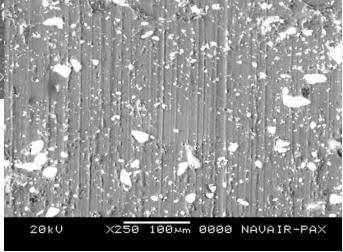

Cap with Chrome Rod

Jeff Gribble

NAVAIR-PAX Hydraulic Systems

Cap with HVOF As-Ground Rod

X250 100 m 0000 NAVAIR-PAX


HCAT March 2005 Greensboro, NC





## **Relative Comparison of Rod / Seal Configurations**

	COLD TEMP (-40 F)	HOT TEMP (250 and 275 F)		TREND
SEAL/ROD CONFIGURATIONS	LEAKAGE	LEAKAGE	TOTAL LEAKAGE	LEAKAGE RATE
HVOF As-Ground - MIL-P-83461 O-Ring w/ Cap	Moderate	Low	Low	Low
HVOF 20-22 Ground w/ SF - MIL-P-83461 O-Ring w/ Cap	None	Low	Low	Low
HVOF 8-10 Ground w/ SF - MIL-P-83461 O-Ring w/ Cap	Low	Low	Moderate	Low
Chrome - MIL-P-83461 O-Ring w/ Cap	Low	High	High	High
HVOF As-Ground - MIL-P-83461 O-Ring w/ 2 Backup Rings	High	Low	High	Moderate
HVOF 20-22 Ground w/ SF - MIL-P-83461 O-Ring w/ 2 Backup Rings	N/A	N/A	N/A	Low
HVOF 8-10 Ground w/ SF - MIL-P-83461 O-Ring w/ 2 Backup Rings	None	Moderate	Moderate	Moderate
Chrome - MIL-P-83461 O-Ring w/ 2 Backup Rings	High	Low	Moderate	Low
HVOF As-Ground - Fluorosilicon O-ring w/ PTFE Cap	Low	Moderate	Moderate	Moderate
HVOF 20-22 Ground w/ SF - Fluorosilicon O-ring w/ PTFE Cap	Moderate	High	High	Moderate
HVOF 8-10 Ground w/ SF - Fluorosilicon O-ring w/ PTFE Cap	Moderate	High	High	High
Chrome - Fluorosilicon O-ring w/ PTFE Cap	Low	High	High	High
HVOF As-Ground - Spring Energized PTFE	Low	Low	Low	Low
HVOF 20-22 Ground w/ SF - Spring Energized PTFE	Low	Low	Low	Low
HVOF 8-10 Ground w/ SF - Spring Energized PTFE	Low	Moderate	Low	Low
Chrome - Spring Energized PTFE	Low	High	High	High
HOT/COLD TEMP LEAK AGE	TOTAL LEAK AGE		TREND LEAKAGE	RATE
Low – less than 3 ml	Low – less than 9 ml		Low – less than 0.08 i	ml/hr
Moderate – 3 to 7 ml	Moderate – 9 to 20 ml		Moderate – 0.08 to 0.14 ml/hr	
High – greater than 7 ml	High – greater than 20 m	1	High – greater than 0.	14 ml/hr

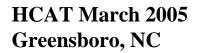



## NAVWAIR

Ranking	Rod/Seal Configuration
Superior Performance	HVOF 20-22 Ground w/ SF with MIL-P-83461 O-Ring/Cap HVOF As-Ground with Spring Energized PTFE HVOF 20-22 Ground w/ SF with Spring Energized PTFE HVOF 8-10 Ground w/ SF with Spring Energized PTFE HVOF As-Ground with MIL-P-83461 O-Ring/Cap
Fair Performance	* HVOF 8-10 Ground w/ SF with MIL-P-83461 O-Ring/Cap  * HVOF 8-10 Ground w/ SF with MIL-P-83461 O-Ring/2 Backup Rings  HVOF As-Ground with Fluorosilicon O-ring/PTFE Cap  * Chrome with MIL-P-83461 O-Ring/2 Backup Rings  * HVOF As-Ground with MIL-P-83461 O-Ring/2 Backup Rings  HVOF 20-22 Ground w/ SF with Fluorosilicon O-ring/PTFE Cap
Worst Performance	Chrome with MIL-P-83461 O-Ring/Cap Chrome with Fluorosilicon O-ring/PTFE Cap Chrome with Spring Energized PTFE HVOF 8-10 Ground w/ SF with Fluorosilicon O-ring/PTFE Cap

<sup>\*</sup> O-ring w/ backup ring config had seals replaced during test.

HCAT March 2005 Greensboro, NC





### F/A-18 C/D Stabilator Actuator

- Based on laboratory results, fluorocarbon static seals and PTFE spring energized dynamic seals in primary and secondary glands were selected.
- Rebuild kits for F/A-18 C/D stabilator actuator were developed by three seal vendors using hardware dimensions.
- Seal kits showed no external leakage and acceptable internal leakage after endurance testing. Post-test leakage was within ATP limits.
- Follow-on testing evaluated HVOF coated rod against these seals.
  - HVOF Coat short external end with WC/Co/Cr 86/10/4
  - HVOF Coat longer internal end with WC/Co 83/17
  - Ground to 8 16  $\mu$ in Ra finish and superfinish to  $\leq 2 \mu$ in Ra finish
- Leakage performance was equivalent to chrome plated rod.


HCAT March 2005 Greensboro, NC





## F/A-18 C/D Stabilator Actuator Continued

- STAB actuator testing is complete and report is finalized by NAVAIR.
- ECP-950 validation is complete. Verification (reviewing component process procedure) has not been performed. Currently have seal kits and are awaiting installation tooling. This will be done at JAX.

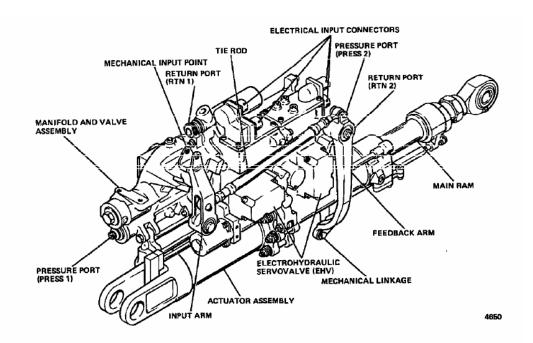








## F/A-18 C/D Trailing Edge Flap

- Same dynamic and static seal materials used for TEF as proven on STAB.
- Side by side design allows one chrome rod and one HVOF rod to evaluate seals against both rod surfaces.
  - HVOF Coat OD of Piston Rod with WC/Co/Cr 86/10/4
  - Ground to 8 16  $\mu$ in Ra finish and superfinish to  $\leq 2 \mu$ in Ra finish
- Endurance testing of TEF is complete and report is currently being written.
- ECP validation and verification is not complete. Awaiting seal kits at NADEP North Island.

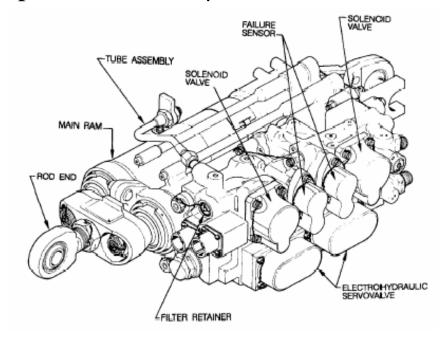


HCAT March 2005 Greensboro, NC





## F/A-18 C/D Rudder and Aileron

- End gland for the chrome piston rod have a SE PTFE in the primary gland. The secondary gland is an o-ring with PTFE capstrip.
- Testing began this week at PAX.
- Seal upgrade may need further delta testing with HVOF coated rod qualification or similarity qualification may be acceptable with analysis.

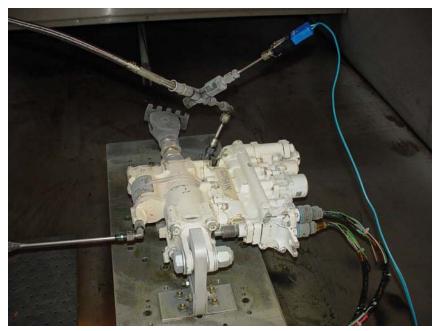



HCAT March 2005 Greensboro, NC





#### **H-60 Main Rotor Servo-Actuator**

- Investigate, evaluate, and qualify improved technology seals with HVOF rod coatings for joint Armed Services. Leveraging data from F/A-18 seal efforts to provide candidates for H-60.
- OEM perform Engineering Investigation on both Army and Navy primary and tail rotor servos to substantiate reliability data, determine root cause of leakage, and determine if additional changes would be recommended.
  - EI includes: test fluid sample, conduct ATP, analyze dynamic seals, provide final report.
  - Current proposal includes piston gland change, new seal material and configuration, and utilization of tungsten carbide cobalt chrome rod coating vice existing chrome.
  - Perform qualification test of current configuration in parallel with modified servo to establish baseline and quantify performance improvement of modifications.
  - Proposed Qual test includes: ATP (pre and post test), fully loaded endurance testing with sand, dust, salt fog and temps from –65 to 275 degrees F.

HCAT March 2005 Greensboro, NC





### Functional Rod/Seal Test Phase II Plan Ahead

- Decide on seal and rod configurations to be evaluated.
- Petition seal vendors for seals and obtain desired rods to support test.
- Order up a new control valve and positioning sensor.
- Setup and begin testing by August 2005.
- Report Phase II results at Jan 2006 HCAT Conference.
- Document Phase I and II results in final report. Results to include the characterization of the rods and seals, measurements of fluid leakage, and noteworthy seal wear and rod finish traces.

